



DATE	INVOICE #
5/26/1999	99308

CUSTOMER INFORMATION	VEHICLE INFORMATION
	1977 911 CARRERA 3.0 COLOR: BLUE MILEAGE:

QTY	ITEM	DESCRIPTION: LABOR/PARTS	EAC...	SUM \$
1	AUTO PART	ENGINE BUILDERS 3.2 CONVERSION SET FROM ENGINE BUILDERS	2295.00	2,295.00
1	CORE	CORE CHARGE FOR 3.2 LINERS FOR ENGINE BUILDERS	300.00	300.00
1	100.907.03	(930)UPPER GASKET SET	198.00	198.00
1	105.509.00	(930)SUPPORT ARM,CHAIN TENSIONER SPROCKET,LEFT	78.00	78.00
1	105.510.00	(930)SUPPORT ARM,CHAIN TENSIONER SPROCKET,RIGHT	78.00	78.00
2	SUBLET	RE-GRIND CAMSHAFT TO 2021:485I/452E-238I/226E-112.5 LC--7OL@.050	295.00	590.00
12	SUBLET	OVERHAUL ROCKER ARMS	19.50	234.00
12	105.342.04	(901)ROCKER SHAFT	6.95	83.40
1	606.230.00	(911)OIL PRESSURE SWITCH	8.30	8.30
5	105.222.06	(911)GUIDE RAMP,TIMING CHAIN,BLACK	4.95	24.75
1	105.222.05	(911)GUIDE RAMP,TIMING CHAIN,BROWN	4.95	4.95
10	GTX20/50	CASTROL MOTOR OIL&DISPOSAL,PER QUART	2.25	22.50
1	OC54	OIL FILTER	9.95	9.95
4	107.351.01	(901)OIL RETURN TUBE	9.54	38.16
1	SHIPPING	SHIPPING CHARGES FROM ENGINE BUILDERS AND CYLINER PEOPLE	40.00	40.00
20.8	HOURS LAB...	R&I ENGINE, R&I HEADS, PISTONS/CYLINDERS, RODS, ASSEMBLE	55.00	1,144.00
1	HOURS LAB...	POLISH AND PAINT HEAD STUDS	55.00	55.00
		SUBTOTAL FOR ABOVE		5,204.01
6	SUBLET	OVERHAUL CONNECTING ROD	44.00	264.00
1	103.148.00	(930)ROD BEARING SET	75.00	75.00
1	RTE.4003	ARP 911 ROD BOLT SET	225.00	225.00
2	HOURS LAB...	EXTRA TIME TO R&I CONNECTING RODS, SEND OUT FOR OVERHAUL, REPLACE BEARINGS, BOLTS, NUTS	55.00	110.00
		SUBTOTAL FOR ABOVE		674.00
1	USED PART	964 DISTRIBUTOR AND WIRES FOR TWINN PLUG	500.00	500.00
1	SUBLET	MODIFY 964 DISTRIBUTOR TO FIT 3.0 ENGINE	275.00	275.00
12	FR5DTC	BOSCH SPARK PLUG(5920)	7.15	85.80
2	CRN.730.0892	CRANE LX92 INGNITION COIL	89.95	179.90
2	CRN.6000.6...	CRANE HI-6-TR IGNITION SYSTEM W/ADJUSTABLE TIMING	349.95	699.90
1	SUBLET	MACHINE HEADS AND EXHAUST VALVLE COVERS TO ACCEPT TWINN PLUGS	350.00	350.00
1	SHIPPING	SHIPPING CHARGES TO/FROM INCLUDING INSURANCE	40.00	40.00
2	HOURS LAB...	EXTRA TIME TO CONVERT TO TWINN PLUG	55.00	110.00
		SUBTOTAL FOR TWINN PLUG		2,240.60
1	SUBLET	VALVE JOB	175.00	175.00

THIS IS YOUR ESTIMATE COPY. PLEASE SIGN HERE;	Total
---	--------------

DATE	INVOICE #
5/26/1999	99308

CUSTOMER INFORMATION	VEHICLE INFORMATION
 527-855617/257-5371/33741	1977 911 CARRERA 3.0 COLOR: BLUE MILEAGE:

PAID

QTY	ITEM	DESCRIPTION: LABOR/PARTS	EAC...	SUM \$
1	SUBLET	RE-SURFACE HEADS	145.00	145.00
1	SUBLET	REPLACE ALL GUIDES	115.00	115.00
1	SUBLET	REPAIR EXHUAST STUDS	25.00	25.00
1	105.419.51	(930)EXHAUST VALVE(0782)	52.50	52.50
5	105.419.13	(930)INTAKE VALVE(7691)	42.50	212.50
12	104.321.51	(901)VALVE GUIDE,STANDARD	6.75	81.00
1	SHIPPING	SHIPPING CHARGES, TO/FROM OLLIE'S W/INSURANCE	60.00	60.00
		SUBTOTAL FOR OLLIES TO OVERHAUL HEADS (INSTEAD OF \$245)		866.00
2	03.362	BOSCH DISTRIBUTOR CAP	59.19	118.38
2	04.216	BOSCH DISTRIBUTOR ROTOR	26.99	53.98
1	AL400X	REBUILT BOSCH ALTERNATOR,OUTRIGHT	250.00	250.00
1	10X825	V-BELT,LATEST GERMAN CONTINENTAL DESIGN	8.00	8.00
1	603.902.0	(928)FAN MOUNTING KIT(FOR UPDATED ALTERNATOR)	18.31	18.31
1	603.127.00	(911)ALTERNATOR NUT PLASTIC CAP	1.95	1.95
1	116.011.22	(915)CLUTCH DISC	215.00	215.00
1	113.057.52	(999)MIAN SEAL--65X85X10(2340)	17.50	17.50
6	102.171.00	(911)FLYWHEEL BOLT	9.25	55.50
2	211.622.01	(930)HOSE,LOPRENE W/ENDS,HEAT EXCHANGER TO BODY,911/912 ALL	24.00	48.00
4	HOURS LAB...	EXTRA TIME TO REPAIR AND PREP SHEET METAL FOR POWDER COATING, RE-WIRE HARNESS TO RELOCATE OIL PRESSURE SWITCH & UPDATE ALTERNATOR.ADD OXY SENSOR PORT TO MUFFLER,R&I FLYWHEEL,REPLACE MAIN SEAL	55.00	220.00
		SUBTOTAL FOR EXTRAS ABOVE		1,006.62
0	HOURS LAB...	CHECK OUT FUEL DOOR AND HOOD RELEASES,F/R FENDER LIP	55.00	0.00
	DISCOUNT	TRADED IN C2 LEATHER SEATS	-1000.00	-1000.00
	DISCOUNT	TRADED SC SEATS, MUFFLER, 3.0 P&L'S	-400.00	-400.00
	DISCOUNT	DISCOUNT FROM RETAIL	-3000.00	-3000.00
	PAYMENT	RECEIVED ON ACCOUNT-9/9/99-CHECK	-2700.00	-2700.00
	SHIPPING	SHIPPING CHARGES	511.96	511.96

THIS IS YOUR ESTIMATE COPY. PLEASE SIGN HERE;	Total	\$3,403.19
---	--------------	------------

DATE	INVOICE #
10/4/1999	99578

PAID

CUSTOMER INFORMATION	VEHICLE INFORMATION
[REDACTED]	1977 911 CARRERA 3.0 COLOR:BLUE MILEAGE:179K


QTY	ITEM	DESCRIPTION: LABOR/PARTS	EAC...	SUM \$
4	341.422.00	(914)FRONT SUSPENSION ARM BUSING, 911/914/914 ALL	15.46	61.84T
2	341.049.01	(911)BALL JOINT(7913)	69.00	138.00T
1	TB.321	21mm FRONT TORSION BAR	224.95	224.95T
4	HOURS LAB...	R&I FRONT A-ARMS AND TORSION BARS, CLEAN AND INSPECT TORSION BARS, REPLACE BUSHINGS	55.00	220.00
1	HOURS LAB...	EXTRA TIME TO MODIFY FRONT A-ARMS FOR AFTERMARKET SWAY BAR, AND FOR DEALING WITH RUSTY PARTS	55.00	55.00
		SUBTOTAL FOR ABOVE		699.79
2	333.195.00	(901)INNER SPRING PLATE BUSHING, OE RUBBER	14.95	29.90T
4	DELRING AF	BUSHING MATERIAL. PER INCH	15.00	60.00T
1	TB.426	26mm REAR TORSION BAR	274.95	274.95T
4	331.059.00	(901)BUSHING. REAR CONTROL ARM, 911 912 ALL YEARS	25.01	100.04T
7	HOURS LAB...	R&I REAR SPRING PLATES, TORSION BARS, CLEAN AND INSPECT TORSION BARS, REPLACE INNER SPRING PLATE BUSHINGS WITH OE RUBBER, FABRICATE CUSTOM FIT OUTER BUSHINGS FROM DELRIN AF	55.00	385.00
2	HOURS LAB...	EXTRA TIME TO DEAL WITH SEIZED PARTS, AND TO REPLACE TRAILING ARM BUSHINGS	55.00	110.00
		SUBTOTAL FOR ABOVE		959.89
1	SUBLET	CAD PLATE ALL SUSPENSION HARDWARE	55.00	55.00T
1	SHIPPING	SHIPPING CHARGES FOR SUSPENSION HARDWARE, TO/FROM	14.00	14.00
1	SUBLET	ALIGN FRONT AND REAR SUSPENSION	110.00	110.00T
1	SUBLET	DYNAMICALLY BALANCE FRONT WHEELS	18.00	18.00T
		SUBTOTAL FOR ABOVE		197.00
1	AUTO PART	AF30 MIXTURE DIGITAL DISPLAY	145.00	145.00T
1	0.258.003.234	OXYGEN SENSOR, THREE WIRE	95.00	95.00T
3	HOURS LAB...	ADD OXY SENSOR, INSTALL DISPLAY, WIRE SYSTEM, REDUCED RATE	35.00	105.00
		SUBTOTAL FOR ABOVE		345.00
1	HOURS LAB...	LAGUNA SECA TICKETS	100.00	100.00
1	AUTO PART	INTERIOR DOOR RELEASE LEVER BUSHING	0.95	0.95T
1	HOURS LAB...	REPLACE ABOVE, FASTEN LOOSE GARNISH RAIL AND DOOR POCKET ON DRIVERS SIDE-NO CHARGE	0.00	0.00
		SUBTOTAL FOR ABOVE		100.95
		Sales Tax	7.25%	95.24

I APPRECIATE YOUR BUSINESS. THANK YOU VERY MUCH.

Total

\$2,397.87

DATE	INVOICE #
11/15/1999	99664

CUSTOMER INFORMATION	VEHICLE INFORMATION
	1977 911 CARRERA 3.0 COLOR:BLUE MILEAGE:179K

PAID

QTY	ITEM	DESCRIPTION: LABOR/PARTS	EAC...	SUM \$
2	SUBLET	OVERHAUL AND RE-VALVE REAR SHOCKS TO SPORT SETTING	85.00	170.00T
2	SHIPPING	SHIPPING CHARGES TO/FROM	8.00	16.00
0.75	HOURS LAB...	R&I REAR SHOCKS	55.00	41.25
		SUBTOTAL FOR ABOVE		227.25
2	HOURS LAB...	REPLACE STEERING WHEEL AND PARTS LISTED BELOW, PROPERLY FASTEN	55.00	110.00
		COLUMN CLAM SHELLS		
1	347.099.05	(911)TURN SIGNAL CANCELER/SLIP RING	14.75	14.75T
1	613.521.00	(911)HORN SLIP RING WIPER CONTACT	4.95	4.95T
1	MATERIALS	SMALL FASTENERS,ASSEMBLY MATERIALS	5.00	5.00T
		SUBTOTAL FOR ABOVE		134.70
2	HOURS LAB...	FASTEN SPEAKER IN REAR	55.00	110.00
		SUBTOTAL FOR ABOVE		110.00
1	635.101.20	(911)HORN, HIGH TONE	41.70	41.70T
1	635.102.20	(911)HORN, LOW TONE	41.70	41.70T
1	HOURS LAB...	INSTALL AND WIRE MISSING HORNS	55.00	55.00
		SUBTOTAL FOR ABOVE		138.40
1	USED PART	DOOR FLIP HINGE/LOCK	10.00	10.00T
2	HOURS LAB...	FIX AND RE-TAP LOWER POCKET SCREW HOLES. REPLACE FLIP LOCK,	45.00	90.00
		INSTALL DOOR POCKET AND GARNISH RAIL-REDUCED RATE		
		SUBTOTAL FOR ABOVE		100.00
		Sales Tax	7.25%	20.89

I APPRECIATE YOUR BUSINESS. THANK YOU VERY MUCH.	Total	\$731.24
--	--------------	----------



1119 Los Olivos Ave.
Los Osos, CA 93402
1-888-GOWESTY (469-3789)

REPAIR INVOICE

Rep.	Date	Invoice #
	10/4/2002	6613

CUSTOMER INFORMATION	VEHICLE INFORMATION
----------------------	---------------------

[REDACTED]

1977 SEBASTIAN RIVERA 3.0
CORP
MILEAGE: 206,775KM

Qty.	Item	Description: Parts/Labor	Each	Total
1	0-261-200-065	ECU, 2.1 VANO, REBUILT, EXCHANGE (\$100 CORE CHARGE), SAME AS #130117 OR 130118	395.00	395.00T
1	ENGINE	REFUNDABLE CORE UNIT	100.00	100.00T

We appreciate your business. Our bar #ARD178808 PLEASE SIGN HERE:	Sales Tax (7.25%)	\$35.89
	Total	\$530.89



1119 Los Olivos Ave.
 Los Osos, CA 93402
 1-888-GOWESTY (469-3789)

REPAIR INVOICE

Rep.	Date	Invoice #
	8/27/2002	6426

CUSTOMER INFORMATION	VEHICLE INFORMATION
[REDACTED]	1977 SERRERA 3.0 CO... MILEAGE: 206,775KM

Qty.	Item	Description: Parts/Labor	Each	Total
1	AUTOPART	911 VALVE ADJUSTMENT KIT, SILICON BEAD EXHAUST, BLACK GRAPHITE INTAKE, OIL SUMP GASKETS AND HARDWARE 30-105-195-00	43.65	43.65T
10	FLUIDS	MOBIL ONE-SUPPLIED	0.00	0.00T
1	AUTOPART	OIL FILTER, LATE 911, 930-107-764-00 (IMC)	9.95	9.95T
4	HOURS LABOR	R&I VALVE COVERS, ADJUST VALVES, CHANGE OIL AND FILTER, SUBTOTAL	65.00	260.00 313.60
0	AUTOPART	SWITCH, WINDOW 911-613-621-03 (IMC)-NEEDS WINDOW MOTOR, AND SHOULD HAVE SWITCH TOO-CURRENT ONE IN INCONSISTANT.	28.43	0.00T
0.25	HOURS LABOR	CHECK OUT DRIVER WINDOW INOP-DIAGNOSE ONLY SUBTOTAL	65.00	16.25 16.25
0.75	HOURS LABOR	SET MIXTURE AND TIMING-NOTE: STALLS WHEN RETURNING TO IDLE-PROBABLY TOO RICH, MAYBE A TIMING ISSUE-ELECTRONIC IGNITION TIMING CONTROL ON MAY HAVE BEEN MOVED	65.00	48.75
0.1	HOURS LABOR	CHECK FOR OIL LEAKS-CUSTOMER STATES IT DOES NOT LOOK LIKE MOTOR OIL-TRANS HAS SLIGHT LEAK	65.00	6.50
1	HOURS LABOR	89 CAMPER TOWING FROM CAYUCOS-BALANCE AFTER AAA TOWING, INCLUDING SHOP DISCOUNT FROM CHUCK'S.-PAID WITH CHECK #20947	20.00	20.00

We appreciate your business. Our bar #ARD178808 PLEASE SIGN HERE:	Sales Tax (7.25%)	\$3.89
	Total	\$408.99



1119 Los Olivos Ave.
 Los Osos, CA 93402
 1-888-GOWESTY (469-3789)

REPAIR INVOICE

Rep.	Date	Invoice #
	4/4/2003	7408

CUSTOMER INFORMATION	VEHICLE INFORMATION
[REDACTED]	1977 SEAT ARRERA 3.0 COUPE MILEAGE: 206,775KM

Qty.	Item	Description: Parts/Labor	Each	Total
1	AUTOPART	SUMP SERVICE KIT, NUTS, SEALING WASHERS, GASKETS	15.00	15.00T
1	AUTOPART	OC 54 OIL FILTER, GERMAN MAHLE BRAND	12.95	12.95T
4	5/30 MOBIL 1	MOBIL ONE 10/30 WEIGHT MOTOR OIL, PER QUART (CUSTOMER WILL PROVIDE 8 QUARTS OF MOBIL ONE OIL)	7.95	31.80T
2	HOURS LABOR	CHANGE OIL AND FILTER, R&I SUMP PLATE, BEAD BLAST AND PAINT SUMP PLATE BLACK, ADJUST ALL SUMP PLATE STUDS TO EVEN HEIGHTS, AJUST TIMING	65.00	130.00
		SUBTOTAL		189.75
2	HOURS LABOR	REPLACE SPARK PLUG WIRES FOR DUEL DISTRIBUTOR MOTOR	65.00	130.00
		SUBTOTAL		130.00
1	AUTOPART	WINDOW MOTOR 0-130-821-017 (WP)	223.25	223.25T
2.4	HOURS LABOR	REPLACE LEFT WINDOW MOTOR	65.00	156.00
		SUBTOTAL		379.25
0.25	HOURS LABOR	CHECK IGNITION TIMING @ 30 DEGREES FULL ADVANCE	65.00	16.25
	REVISION	REVISED ESTIMATE BY PHONE: TIME:5:05 _DATE:04-03-03_BY:_ED	0.00	0.00T
		SIGNED: _____		

We appreciate your business. Our bar #ARD178808	Sales Tax (7.25%)	\$20.52
	Total	\$735.77

PLEASE SIGN HERE:



1119 Los Olivos Ave.
 Los Osos, CA 93402
 1-888-GOWESTY (469-3789)

REPAIR INVOICE

Rep.	Date	Invoice #
	3/31/2004	9999

CUSTOMER INFORMATION	VEHICLE INFORMATION
[REDACTED]	1977 SAAB 900 RRRERA 3.0 COIL SPRING MILEAGE: 217,490 KM

Qty.	Item	Description: Parts/Labor	Each	Total
2.25	HOURS LABOR	CHECK TUNE UP NOT PASSING SMOG. ADJUST TIMING & IDLE & MIXTURE AS NEEDED TO PASS SMOG. TAKE OVER TO SMOG SHOP 2 TIMES. SUBTOTAL	70.00	157.50 157.50
11	20/50	MOBIL 20/50 MOTOR OIL & DISPOSAL, PER QUART	2.49	27.39T
1	OC54	OIL FILTER, 911	9.65	9.65T
0.75	HOURS LABOR	CHANGE MOTOR OIL & FILTER WARM UP MOTOR AS NEEDED TO GET OIL LEVEL FILLED TO PROPER LEVEL.	70.00	52.50
	REVISION	REVISED ESTIMATE BY PHONE: TIME: _5:30 DATE: _3/31/03_ BY: _ED_ SIGNED: _____	0.00	0.00T

We appreciate your business. Our bar #ARD178808 PLEASE SIGN HERE:	Sales Tax (7.25%)	\$2.69
	Total	\$249.73



1119 Los Olivos Ave.
 Los Osos, CA 93402
 1-888-GOWESTY (469-3789)


REPAIR INVOICE

Rep.	Date	Invoice #
	3/9/2004	9797

CUSTOMER INFORMATION	VEHICLE INFORMATION
[REDACTED]	1977 SEVILLA RRRERA 3.0 CONFINDE MILEAGE:217,154 KM

Qty.	Item	Description: Parts/Labor	Each	Total
12	893-407-237	BOLT,AXLE LATE VANO 12 POINT	1.92	23.04T
1	AUTO PART	CV BOOT 901-332-293-12	24.95	24.95T
3	HOURS LABOR	R&R LEFT REAR DRIVE AXLE & REPLACE OUTER CV BOOT & ALSO REPAIR BROKEN BOLTS ON INNER CV FLANGE ALSO REPLACE INNER CV BOLTS ON RIGHT SIDE	70.00	210.00

We appreciate your business. Our bar #ARD178808 PLEASE SIGN HERE:	Sales Tax (7.25%)	\$3.48
	Total	\$261.47

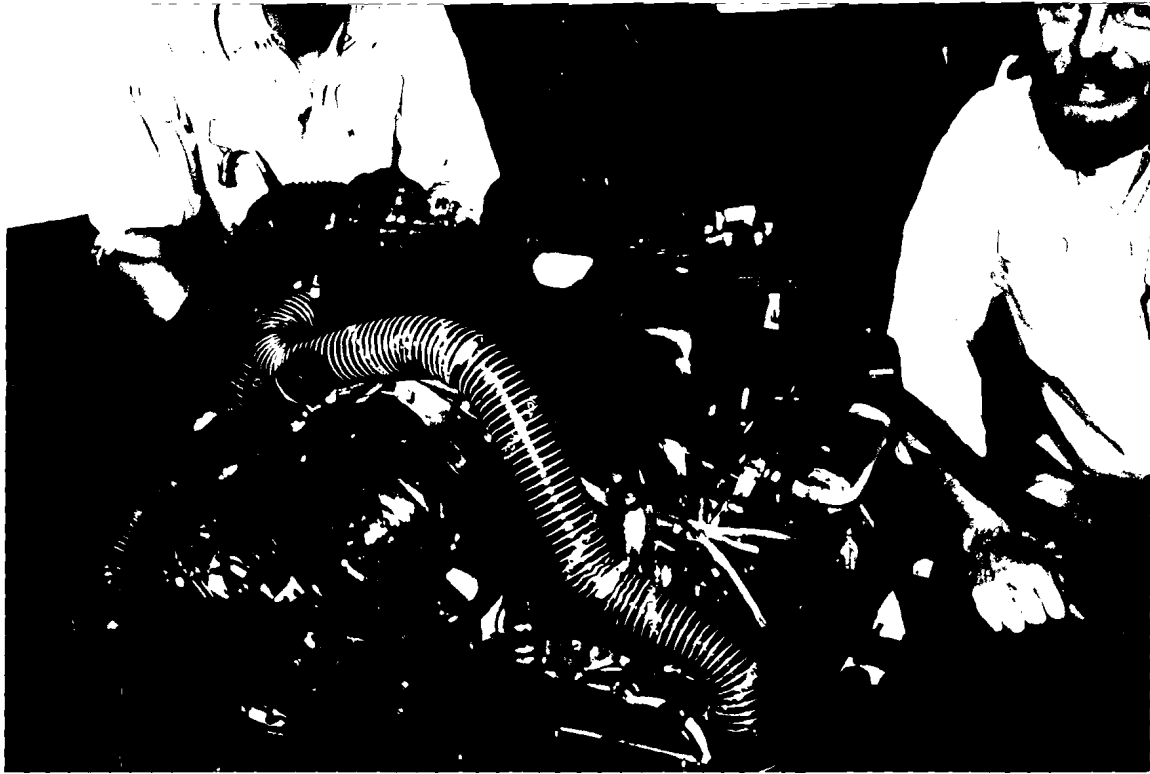

*Lightweight Plywheel
+
New Transmission
3/24/92*

*1st Custom Motor
Detailed*

